

ProLinea 575e

System Boards	Assembly	Spare Part
System Board, w/o Processor	005312	223553-001

Configuration Jumper Settings (005312)

Jumper	Function	Setting	Description
P2	Clear CMOS Settings		Remove jumper cover for 60 sec, then replace it.
P3	Password Enable/Disable	1 – 2	Password Enabled
		2 – 3	Password Disabled
P5	Processor Clock Speed	2 – 3	50 MHz ext, 75 MHz internal
		2 – 3	50 MHz external, 100 MHz internal
		1 – 2	60 MHz external, 120 MHz internal
P11	Processor Clock Speed	1 – 2	50 MHz ext, 75 MHz internal
		2 – 3	50 MHz external, 100 MHz internal
		2 – 3	60 MHz external, 120 MHz internal

Microprocessors	Spare Part
P54C/75	172671-001

Memory	Assembly	Spare Part
4 MB SIMM, 70ns	172707-002	172718-001
8 MB SIMM, 70ns	172707-003	172719-001
16 MB SIMM, 70ns	172707-004	172938-001
32 MB SIMM, 70ns	172707-005	172939-001
1 MB Video Memory, DRAM ¹	004120-001	171044-001
2 MB Video Memory, VRAM ²	003971-001	172467-001
2 MB Video Memory, VRAM ³	004539-001	137895-001
Cache, L2, 256KB	223529-001	223581-001

¹ PCI Local Bus. ² 1280/P+. ³ QVision 2000+.

Miscellaneous	Assembly	Spare Part
Backplane	005211-001	223543-001
Backplane (for config codes HTC4, HTB4)	005211-002	223659-001
Enhanced Bus. Audio Board	004198-001	172078-001
Speaker w/ Bracket	141045-001	172831-001
Speaker w/o Bracket	141045-001	141336-001
Adapter, ext AUI to BNC Enet	142858-002	192768-001
Keyboard, U.S.	160650-101	160648-201

Controller Boards	Assembly	Spare Part	Page
IDE Controller	002172-001	171745-001	X
6260 SCSI-2 Controller	004004-001	133880-001	A-6
Ethernet ISA Controller w/ Slot Bracket	003086-001	147220-001	X
SCSI ISA Controller, Plug & Play	184750-001	184751-001	X
32-Bit, PCI, Fast-Wide SCSI-2 Controller	003654-001	199633-001	X
Serial/Parallel I/F Board	000990-003	106886-002	A-10
NetFlex TR, ISA	160782-001	142836-001	X
IBM-Compatible Auto 16/4 Token Ring	172441-002	172194-001	X
QVision 1280/I, ISA, w/ 1MB VRAM	003968-001	137898-001	X
QVision 1280P+, ISA, w/ 2MB VRAM	002951-001	139182-001	X
QVision 2000+ Graphics, PCI, Controller	004111-001	137897-001	X
NetFlex-3 ENET, PCI Controller	003086-001	147220-001	X
Millennium, Graphics, 2MB	005409-002	223337-001	X

ProLinea 575e

CD-ROM Drive	Spare Part
CD-ROM, Internal, Quad Speed, IDE	172717-001

Hard Drives	Spare Part
535 MB Fast SCSI-2	148286-001
630 MB IDE	173114-001
720 MB IDE	172842-001
1.05 GB Fast SCSI-2	142039-001
1.08 MB IDE, DFP	172941-001
2.1 GB Fast SCSI-2	142272-001

Tape Drives	Spare Part	Tape Cartridge	Spare Part
340/680 MB with Compression	187658-001	340 MB	184299-001
		680 MB	184300-001
525 MB ACA	142073-201	525 MB	119504-001
1.2 GB ACA	199615-001	1.2 GB	199625-001
2/8 GB DAT	142074-201	2.0 GB DAT	131148-001
		5.0 GB DDS2	199496-001
4 GB TR4, IDE	294126-001	4 GB TR4	294140-001

Diskette Drives	Spare Part
1.44 MB, 3-Mode, 1/3 Height	160788-201
1.2 MB, 1/2 Height	141367201

28.8k-bps Modem	Spare Part
Country	
DOM/US	259214-002
INT'L/UK	223607-031
INT'L/GR	223607-041
INT'L/FR	223607-051

Cables	Spare Part
Kit: IDE CD-ROM/HD Cable (2); Audio Cables (2)	172478-001
Kit: DT Audio Cable (1); Minitower Audio Cable (1)	171139-001
Diskette Drive Cable	172477-001
2-Device SCSI, 3-Connector	146997-001
LED Assembly	172531-001
Hard Drive Select cable	172945-001
Token Ring Cable	172844-001
2-Device SCSI, 3-Connector, Plug and Play	184118-001
IDE, CD-ROM/HD CD, SMB (for config codes HTB4, HTC4)	223657-001


ROM Information	Spare Part
System ROMPaq	148218-001

Power Supply/Battery	Spare Part
Power Supply, 110 W, U.S.	213929-001
Real-Time Clock Battery (4.5 V alkaline)	160274-001

ProLinea 575e


MEMORY UPGRADE CHART

SYSTEM BOARD W/8MB MEMORY
005312

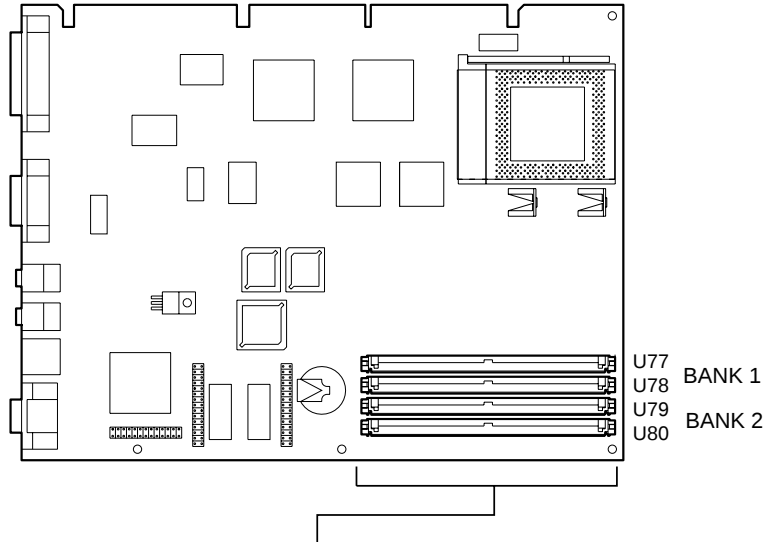

A bank of memory must contain same size memory modules (2 x 4 or 8 or 16 or 32). Populate first half of bank first, then second half. To populate with different size modules, populate first half of bank 1, then first half of bank 2 (i.e., U77 then U79).

UP TO 136 MEGABYTES TOTAL SYSTEM MEMORY



4-MB 70ns - OPTION PN 172712-001

8-MB 70ns - OPTION PN 172713-001

16-MB 70ns - OPTION PN 172714-001

32-MB 70ns - OPTION PN 172715-001